



## Release Note

**Software Version:** 1.18.7.1, 1.18.7

**Models:** W710D,W610D

**Date:** 2025.05.15



## Content

---

<b>Content</b> .....	<b>2</b>
<b>1 Revise History</b> .....	<b>3</b>
<b>2 Release 1.18.7.1 &amp; 1.18.7</b> .....	<b>4</b>
2.1 New Features .....	4
2.2 Optimization .....	4
2.3 Bug Fix .....	4
2.4 Known Issue .....	5
2.5 New Feature Description .....	5
<b>3 Release 1.18.4.1 &amp; 1.18.4</b> .....	<b>7</b>
3.1 Bug Fix .....	7
<b>4 Release 1.18.1</b> .....	<b>8</b>
4.1 New Features .....	8
4.2 Bug Fix .....	8
4.3 Known Issue .....	8
4.4 New Feature Description .....	9

## 1 Revise History

---

No.	Version	Release Time
1	1.16.2	2024.10.09
2	1.18.1	2024.12.03
3	1.18.4.1 & 1.18.4	2025.01.20
4	1.18.7.1 & 1.18.7	2025.05.14

## 2 Release 1.18.7.1 & 1.18.7

---

Models	Software Version	Comment
W710D	1.18.7.1	
W610D	1.18.7	

### 2.1 New Features

1. Add the feature that the W710D Manager support fast paring with handsets by the pressing Reset key
2. Add Slovenian language

### 2.2 Optimization

1. Optimize translation and display of web UI.
2. Optimize the audio quality when using Bluetooth headsets for calls
3. Optimize the pop-up display of W610D
4. Optimize the speed of downloading custom background images for W610D

### 2.3 Bug Fix

1. Fixed the occasional issue that some handsets failed to automatically reconnect after rebooting the Manager.
2. Fixed the issue that W610D configuration parameters failed to sync after W710D configuration updates.

## 2.4 Known Issue

1. When downgrading the W710D Manager from version 1.18.5 to below 1.18.5, the following configuration needs to be manually set to 1, or the system needs to be reset; otherwise, the handset's internal extension number will fail to register:

```
hotspot.Enabled = 0
```

## 2.5 New Feature Description


1. Add the feature that the W710D Manager support fast pairing with handsets by the pressing Reset key.

### Description:

After **Auto Authorized** is enabled, it is not necessary to add the IPUI of the handset on the Manager page. Any handset can connect to the Manager after entering the PIN code. There are two ways to enable Auto Authorized:

1) Press and hold the Reset button for 3 seconds until the ROLE LED and DECT LED flash twice quickly. Release the button, and the device will enter **Auto Authorized** mode (ROLE LED stays on, DECT LED flashes slowly).

**Auto Authorized** mode will be disabled automatically after 90 seconds if you enable it by Reset key.

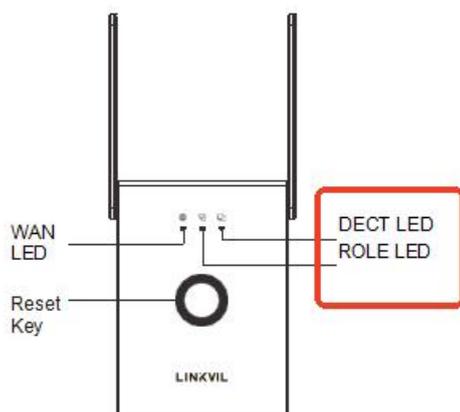

2) You can enable Auto Authorized by access the Manage web> [Devices]> [Handset]> [Maintenance].

After Auto Authorized is enabled from the web page,it will not be disabled automatically. You can access the Manager webpage > [Devices]> [Handset]> [Maintenance] to disable Auto Authorized; You can also press and hold the Reset key for 3 seconds to disable Auto Authorized.



### 3 Release 1.18.4.1 & 1.18.4

---

Models	Software Version	Comment
W710D	1.18.4.1	
W610D	1.18.4	

#### 3.1 Bug Fix

1. Fixed the issue that LDAP phone books could not display root directory search results.
2. Fixed issues related to 3CX server compatibility.
3. Improved translation and display of web UI.
4. Fixed the issue that the device would not auto resume registration when the server was recovered from being unavailable (using 503 to reply to registration messages).

## 4 Release 1.18.1

---

Models	Software Version	Comment
W710D/W610D	1.18.1	

### 4.1 New Features

5. Add the function that uploaded the firmware of W610D locally through the W710D web page.
6. Added the function that W610D can perform vibration notification after the other end answers the call from W610D.

### 4.2 Bug Fix

1. Fixed the issue that W610D occasionally does not get the internal extension number after reconnecting the base
2. Fixed the issue that Static Provisioning Server Address can't save FQDNS except for suffix .cn, .com and etc
3. Fixed the issue that W610D UI occasionally prompts that the handset is not onhook
4. Fixed the issue that W610D occasionally can't automatically reconnect to the network after being disconnected from a distance
5. Fixed the issue that auto provision background images for W610D via W710D occasionally failed.

### 4.3 Known Issue

1. Only software versions 1.9.0 or later of the W610D support upgrade via U disk.
2. The second firmware version number of W710D and W610D must be the same to match each other. For example, if the firmware version number of W710D and W610D is 1.16.2 and 1.16.3, and the second digit are both 16, so they can be matched.

## 4.4 New Feature Description

1. Add the function that uploaded the firmware of W610D locally through the W710D web page.

### Description:

1) Visit W710D Manager webpage >> [Handset] >> [Upgrade]>> [Local Software Upgrade], select the firmware of W610D, auto obtain or manually edit the software version number, click Apply.

Note:

1) The device can only recognize the software version number with the default firmware file name.

2) The submitted software version number must be consistent with the uploaded firmware. If they are inconsistent, the firmware will be upgraded repeatedly.


2) After apply, the firmware will display in the Firmware List ([Handset] >> [Upgrade]>>Firmware List) . And the Handset will upgrade.

Firmware List					
	File Name	Software	Applicable Model	File Size	Operation
<input type="checkbox"/>	w610d-linkvil-release-ff01-9005-1.18.1-krmvUT2024-1-1-29-03.08.21.z	1.18.1	w610d	30 Mb	

3) When the handset is in upgrade status, the standby status bar/screen saver interface displays the upgrade icon

4) It will pause the upgrade when power is off/ during call/network is disconnected, you can see the upgrade pause icon from standby status bar/screen saver interface; and it will continue the upgrade after the recovery.

**Note:** Due to the small DECT bandwidth and the large software file of the handset, the upgrade time of W610D takes about 3~5 hours. Users can also check the upgrade status and progress from the handset menu>advanced>upgrade interface.

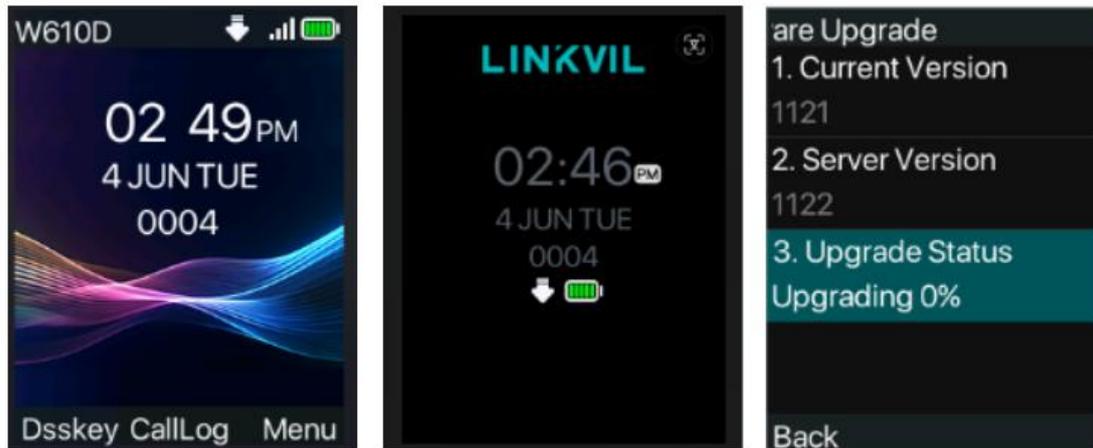

2. Added the function that W610D can perform vibration notification after the other end answers the call from W610D.

**Description:**

Visit W610D LCD >> [Menu] >> [Basic]>> [Ring], enable the Vibrate when answering, press OK to save. When the W610D call others, it will vibrate to alert after other end answer the call.